

G-2010

# **Air Pressure Gauge**




## **Description**

The G-2010 Air Pressure Gauge provides continuous indication of air pressure or On-Off status in pneumatic control systems.



#### **Features**

- available with analog pressure readout or On-Off indicator
- available in 1-1/2 to 3-1/2 in. sizes
- removable clear plastic lens cover for easy cleaning
- easy readability, black printing on white background with equivalent metric scale in blue

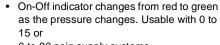

0 to 20 psig supply systems.

 mounts flush on panels 1/16 to 3/4 in. thick, with provided U-clamps, or on surface

## **Repair Parts**

If the product fails to operate within its specifications, unit replacement is required.

## To Order

Specify the code number from the following selection chart.

## **Specifications**

G-2010 Air Pressure Gauge				
Accuracy	3-2-3% of Full Range per ANSI Spec. B40.1M			
Ambient Temp. Limits	-20 to 150°F (-29 to 66°CC)			

#### **Selection Chart**

Code Number	Item				
	Gauge Size (in.)	Range (psig/kPa)	Mounting		
			Flush or Surface	Stem	
G-2010-5 <sup>(a)</sup>	1-1/2	0 to 30/0 to 200		•	
G-2010-1 <sup>(a)</sup>		On/Off Indicator	•		
G-2010-11 <sup>(a)</sup>	2	0 to 30/0 to 200		•	
G-2010-101 <sup>(a)</sup>		0 to 30/0 to 200	•		
G-2010-23 <sup>(a)</sup>		0 to 100/0 to 700			
G-2010-16 <sup>(b)</sup>		0 to 160/0 to 1100		•	
G-2010-24 <sup>(a)</sup>		0 to 160/0 to 1100		•	
G-2010-300 <sup>(a)</sup>	2-1/2	0 to 30/0 to 200	•		
G-2010-302 <sup>(a)</sup>		0 to 100/0 to 700	•		
G-2010-400 <sup>(a)</sup>	3-1/2	0 to 30/0 to 200	•		
G-2010-403 <sup>(a)</sup>		0 to 160/0 to 1100	•		

<sup>(</sup>a) All connections 1/8 in. NPT center back

<sup>(</sup>b) Connection 1/4 in. NPT center bottom