

GE Appliances

Part Install Instructions

WR49X26875

Cold Control Replacement Kit Instructions

Overview


This kit replaces the refrigerator cold control, cold control sleeve, and damper.

Parts Included:


WR09X26871 Cold Control
WR02X26891 Vinyl Sleeve Assembly
WR02X26890 Actuator Air Foam (Damper)
Instruction Sheet

Tools Required:

Philips head screwdriver
Flat head screwdriver

**IMPORTANT SAFETY NOTICE**


The information in this part instruction is intended for use by individuals possessing adequate backgrounds of electrical, electronic and mechanical experience. Any attempt to repair a major appliance may result in personal injury and property damage. The manufacturer or seller cannot be responsible for the interpretation of this information, nor can it assume any liability in connection with its use.

**WARNING**

To avoid personal injury, disconnect power before servicing this appliance. If electrical power is required for diagnosis or test purposes, disconnect the power immediately after performing the necessary checks. RECONNECT ALL GROUNDING DEVICES. If grounding wires, screws, straps, clips, nuts, or washers used to complete a path to ground are removed for service, they must be returned to their original position and properly fastened.


Instructions

1. Disconnect power to refrigerator.
2. Remove food and shelf from freezer section.
3. Remove freezer air tower by using a flat bladed screwdriver. Lift the snaps at the bottom of the tower to disengage the tower from the air duct assembly.
4. Unsnap the sides of the air tower from the evaporator cover.
5. Pull down on air tower to disengage tabs at the top of the tower.
6. Remove ice/frost and dry any moisture in the freezer section.

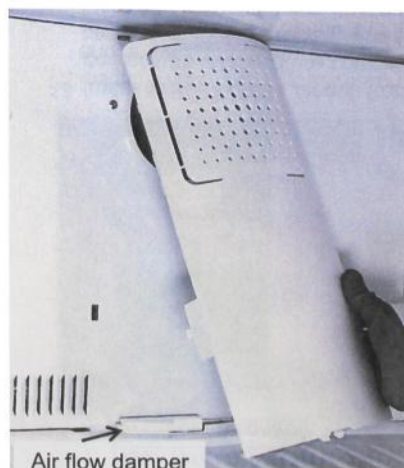

GE APPLIANCES


7. Remove original air foam damper and replace with WR02X25890 air foam damper. Remove any frost or ice from air foam damper area.

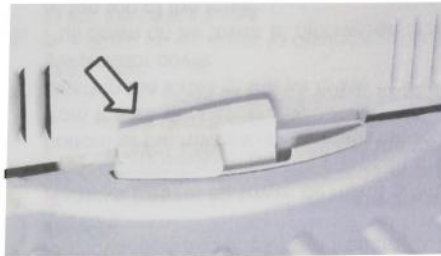


8. Confirm damper is properly seated.
9. Re-install freezer air tower.
10. Remove temperature control knob. Remove 2 Philips head screws that attach housing to top of fresh food liner.
11. Squeeze clips that hold control at rear of housing to release it from the air duct. After the control panel drops, disconnect the 6 pin connector.



'New' WR09X26871
temperature control:

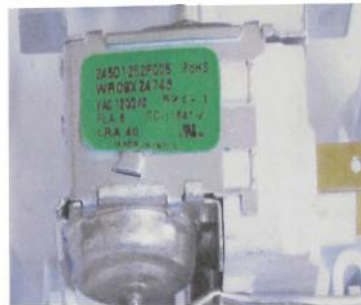

13. Install WR02X26891 sleeve from kit and ensure temperature control capillary is routed properly and fully inserted. Reinstall foam ducting around capillary tube.

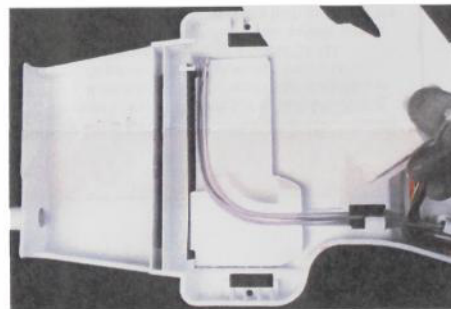

14. Reinstall housing to top of fresh food liner air duct by snapping onto the air duct. Reinstall 2 Philips head