


INSTALLATION INSTRUCTIONS FOR SOLENOID REPLACEMENT KIT - WD21X10060 and MOTOR REPLACEMENT KITS

For Dishwasher Models with Electronic Drain Feedback Switch

The design of the motor drain solenoid has changed. The new design is a one-piece construction, but compatible with older two-piece bolted assemblies.


On models with Electronic Drain Feedback Switch (EDFS), a special adapter bracket must be installed. See model list on back side of this sheet to identify models with EDFS.

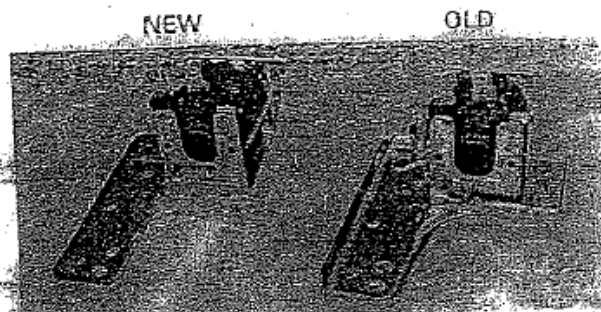

SOLENOID KIT WD21X10060

To replace a solenoid on models with an Electronic Drain Feedback Switch (EDFS):
The new adapter bracket must be installed.
This bracket is included with the Solenoid Replacement Kit.

- Attach the adapter bracket to the new solenoid with the 2 screws provided in the kit.
- Secure the solenoid to the pump housing with original screws.
- Attach EDFS to the adapter bracket with original screw or screw provided.

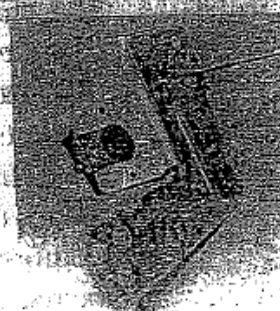


New bracket
attach with
2 self-tapping
screws

MOTOR KIT WD26X10041 or WD26X10007 Typical Mounting Either Kit

To install a new motor with new solenoid on models with an Electronic Drain Feedback Switch.

The new adapter bracket must be installed.
This bracket is included with the replacement motor.

- Attach the adapter bracket to the new solenoid with the 2 screws provided in the kit.
- Attach EDFS to the adapter bracket with original screw or screw provided.

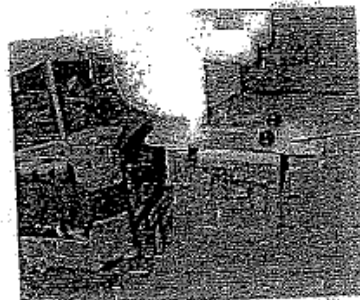

Attach new
bracket
with 2
self-tapping
screws

Solenoid
attached
to motor

