

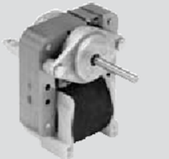
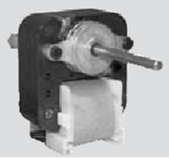




Skeleton Motors

Sleeve Bearing - Shaded Pole

3000 R.P.M.

Skeleton Motors continued from previous

Part #	Amps	Volts	HP	Stack	Rot.	Shaft	Rated	Features	Comment
 R635	0.80	208 230	1/40	1.50	C.W.	1.5"x1/4" 	1700 RPM 0.95 Amps 1/75 HP	Cord c/w spades	CHROMALOX, WESTCAN CONSTRUCTION HEATER
 R3555	0.85	115	1/80	0.65	C.W.	2.4"x7/32" 	3000 RPM 0.85 Amps 1/80 HP	Cord & plug	BROAN NUTONE 65106,33- 106,C68627, EM- 555,SM-555, VFM-106
 R605	0.85	115	1/55	0.90	C.W.	1.7"x.1811" 	2800 RPM 0.90 Amps 1/55 HP	30" cord	HUSSMAN BLANCHARD SM605, 79103, 79104, E310131, P211116966A
 R3551	0.90	115	1/45	0.90	C.C.W.	1.4"x7/32" 	3000 RPM 0.90 Amps 1/45 HP	C-ring groove, three pin two speed plug	BROAN NUTONE 656101, 33-101, C52367, EM-551, SM-551, VFM-101
 R610	0.90	115	1/50	0.90	C.W.	1.2"x7/32" 	2400 RPM 1.00 Amps 1/60 HP	C- ring groove, cord w/ insulated spades, 2 speed	BROAN NUTONE 27898, 64586, 64964, 67846,81734, 81795, 81798, 81800
 R604	0.90	115	1/90	0.65	C.W.	1.2"x.181" 	2700 RPM 0.92 Amps 1/85 HP	Cord & plug	BROAN, NUTONE 217A9871P2, 5007S, 5018S, SM604, 5030S, 04290001, 12657006
 R3554	1.00	115	1/50	0.90	C.W.	1.5"x7/32" 	3000 RPM 1.00 Amps 1/50 HP	C-ring groove, three pin two speed plug	BROAN NUTONE 65105, 33-105, C27987, EM-554, SM-554, VFM-105
 R684	1.00	115	1/70	0.80	C.C.W.	2.1"x7/32" 	3000 RPM 1.00 Amps 1/70 HP	Cord & plug	NUVENT 2000A, D90CB 2584SP, MR. WHISPER
 R607	1.10	115	1/35	1.15	C.C.W.	1.7"x7/32" 	2300 RPM 1.30 Amps 1/50 HP	Spades	HABCO CO21617